## Approved For Releaser 2003 17 223 : CIA-RDP33-02415A000400380115-8

DPD-7528-59

2 November 1959

MEMORANDUM FOR: Acting Chief, DPD-DD/P

SUBJECT

: Malfunction Report, Period Ending 31 October 1959

1. The following malfunction information is presented for the period ending 31 October 1959:

### I. Photographic Equipment

- A. During the period 1 October 1959 through 31 October, there were a total of twenty-one (21) missions reported flown using photographic equipment. Equipments malfunctioned on two (2) of these missions giving an overall effectiveness of 90.05%.
- B. Equipment reliability for the above referenced period was:

| was.           | A-l<br>Conf. | A-2<br>Conf. | B Conf. | Trackers        |
|----------------|--------------|--------------|---------|-----------------|
| Missions Flown | 0            | 3            | 5       | 21              |
| Malfunctions   | 0            | 0            | 0       | 2               |
| Per Cent Eff.  | 0            | 100%         | 100%    | 90 <b>.</b> 05% |

#### C. Tracker Malfunctions:

One tracker malfunction

- (1) (Mission BT-59-211) was due to filter assembly improperly blocking slit. This without a doubt was due to improper pre-flight and must be considered as personnel error.
- (2) No reason has been given for tracker malfunction on Mission BT-59-214. Tracker past flighted o.k., ran for one hour in the special equipments shop without malfunctioning.

# SECRET

#### Approved For Release 2003/12/23 : CIA-RDP33-02415A000400380115-8

# SECRET

DPD-7528-59

Malfunction Report, Period Ending 31 October 1959, (Continued)

### II. Communications

- A. Detachment "B"
  - (1) System III
    - (a) Mission 315, 6 October Lost D.C. Power about two-thirds of the way through the mission. Cause undetermined.
    - (b) Mission 1525, 9 October Planar triode tube in HRB preamp failed, reducing the System III sensitivity.
    - (c) Mission 8649, 30 October The 05 Board of the third local oscillator, Receiver (A), failed at the start of the mission. Cause unknown.
    - (d) Mission 8649, 30 October Recorder 780 failed after  $6\frac{1}{2}$  hours. Cause unknown. Operated properly on post flight check.
- (2) System VII
  - (a) Mission 4139, 4 October Intermittent in 10db altenuator pad. Replaced.
- B. Detachment "C"

No report received from this detachment.

Chief, Materiel Branch DPD-DD/P

25X1

25X1

MB/DPD-DD/

Dist: 10 - A/CH/DPD

- 1 DD/P
- 1 CH/OPS/DPD
- 1 CH/MAT/DPD
- 1 RI/DPD